Section 1 - Chemical Product and Company Information

Product Name: No Mix MS Basecoat BinderProduct Code: LV-301Manufacturer/Supplier:
TRANSTAR AUTOBODY TECHNOLOGIESCHER
USA2040 Heiserman Dr.
Brighton, MI, 48114, USAInterr

CHEMTREC 24 Hour Emergency Phone(s): USA & Canada 800-424-9300 International +1 703 741-5970

Business Phone: 800-824-2843 SDS Prepared By: Transtar Autobody Technologies

Distributor (if applicable):

Product Use: For Professional and Industrial Use Only Not recommended for: Not for sale to the general public

Section 2 - Hazards Identification

Classification of the substance or mixture

GHS Ratings:

Flammable liquid	2	Flash point < 23°C and initial boiling point > 35°C (95°F)
Eye corrosive	2A	Eye irritant: Subcategory 2A, Reversible in 21 days
Organ toxin single exposure	3	Transient target organ effects- Narcotic effects- Respiratory
		tract irritation

GHS Hazards

H225	Highly flammable liquid and vapor
H319	Causes serious eye irritation
H336	May cause drowsiness or
	dizziness

GHS Precautions	<u> </u>
P101	If medical advice is needed, have
D 400	product container or label at hand
P102	Keep out of reach of children
P103	Read label before use
P210	Keep away from heat, hot surfaces,
	sparks, open flames and other ignition
	sources - No smoking
P240	Ground and bond container and
	receiving equipment
P241	Use explosion-proof electrical,
	ventilating, lighting and motorized
	equipment
P242	Use only non-sparking tools
P243	Take precautionary measures against
	static discharge
P261	Avoid breathing dust, mist, vapors and
	spray
P271	Use only outdoors or in a well-ventilated
	area
P280	Wear protective gloves, protective
	clothing, eye protection, face protection
	and respiratory protection.
P312	Call a POISON CENTER or doctor if
	you feel unwell
	,

P303+P361+P353	IF ON SKIN (or hair): Immediately take off all contaminated clothing. Wash skin with soap and water.
P304+P340	IF INHALED: Remove victim to fresh air and keep at rest in a position
P305+P351+P338	comfortable for breathing IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses if present and easy to do - continue rinsing
P337+P313	If eye irritation persists: Get medical attention.
P370+P378	In case of fire: Use dry chemical, CO2, foam or water fog to extinguish
P405	Store locked up
P403+P233+P235	Store in a well ventilated place. Keep container tightly closed. Keep Cool.
P501	Dispose of contents and container in accordance with local, regional, national and international regulations.





Hazards not otherwise classified (HNOC) or not covered by GHS: None known

The following % of the mixture consists of ingredient(s) of unknown acute toxicity. 0%

Section 3 - Composition					
Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits		
Acetone 67-64-1 70 to 80%	1000 ppm TWA; 2400 mg/m3 TWA	750 ppm STEL 500 ppm TWA	NIOSH: 250 ppm TWA; 590 mg/m3 TWA		
Cellulose, acetate butanoate 9004-36-8 10 to 20%					
Propylene glycol monomethyl ether acetate 108-65-6 5 to 10%	TWA 200 ppm	TWA 50ppm			
Ethyl-3-ethoxypropionate 763-69-9 1 to 5%	TWA: 0.75 ppm	CLV: 0.03 ppm			

Section 4 - First Aid Measures

INHALATION: If Inhaled: Remove person to fresh air and keep comfortable for breathing. If breathing difficulty

persists, seek medical attention.

EYE CONTACT: Rinse continuously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing for a minimum of 15 minutes while holding eye lids open. If eye irritation persist: seek medical attention.

SKIN CONTACT: Take off all contaminated clothing immediately. Wash exposed area thoroughly with soap and water. Seek medical attention if irritation persists. Do NOT use solvents or thinners to wash off.

INGESTION: If swallowed, seek medical attention immediately and have product container or label at hand. DO NOT INDUCE VOMITING unless directed to do so by a physician or poison control center. Never give anything by mouth to an unconscious person.

Most important symptoms and effects, both acute and delayed:

Eye contact: Causes serious eye irritation.

Inhalation: Can cause central nervous system (CNS) depression. May cause drowsiness and dizziness. May cause respiratory irritation. Exposure to decomposition products may cause a health hazard. Serious effects may be delayed following exposure.
Skin contact: Causes skin irritation.
Ingestion: Can cause central nervous system (CNS) depression. May be fatal if swallowed and enters airways.

Irritating to mouth, throat and stomach.

Over-exposure signs/symptoms:

Eye contact: Adverse symptoms may include the following:

Pain or irritation, watering, redness

Inhalation: Adverse symptoms may include the following:

Respiratory tract irritation, coughing, nausea or vomiting, headache, drowsiness/fatigue, dizziness/vertigo,

unconsciousness.

Skin contact: Adverse symptoms may include the following:

Irritation, redness.

Ingestion: Adverse symptoms may include the following:

Nausea or vomiting.

Indication of any immediate medical attention and special treatment needed.

Seek professional medical attention for all over-exposures and/or persistent problems.

In case of inhalation of decomposition products in a fire, symptoms may be delayed.

The exposed person may need to be kept under medical surveillance for 48 hours.

Specific treatments: No specific treatment.

Protection of first-aiders: No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation

Section 5 - Fire Fighting Measures

LEL: 1.1 %

UEL: 12.8 %

Extinguishing Media: Dry Chemical, Foam, CO2 or water fog.

Unsuitable Extinguishing Media: High volume water jets

Unusual Fire and Explosion Hazards: Vapors can travel to a source of ignition and flash back. Closed containers may explode when exposed to extreme heat. Hazards apply to empty containers. Combustion generates toxic fumes.

Hazardous Combustion Products: oxides of carbon, oxides of nitrogen, formaldehyde, toxic fume

Special Firefighting Procedures: Highly toxic fumes may be generated by thermal decomposition. Water runoff from firefighting can cause environmental damage. Dike and collect water used to fight fire.

Fire Equipment: Full fire fighter equipment including SCBA should be worn to avoid skin contact and inhalation of

Section 6 - Accidental Release Measures

Personal precautions, protective equipment and emergency procedures:

Use personal protective equipment. Avoid breathing vapors and mist. Ensure adequate ventilation. Eliminate all sources of ignition. Evacuate pesonnel to safe areas. Beware of vapors accumulation to form explosive concentrations. Vapors can accumulate in low areas. For personal protection see section 8.

Environmental precautions:

Prevent further leakage or spillage if safe to do so. Do not let product enter drains.

Methods and materials for containment and cleaning up:

Small Spills: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.

Large Spills: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Contain and collect spillage with non-combustible,

absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations. Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product.

Section 7 - Handling & Storage

Safe Handling Measures: Avoid contact with skin and eyes. Avoid inhalation of vapor or mist. Ground and bond container and receiving equipment. Use non-sparking tools and explosion proof equipment when handling this material. Keep away from sources of ignition - No Smoking. Use in cool, well-ventilated areas. Keep containers closed when not in use. Take measures to prevent the build up of electrostatic charge. Follow all SDS and label precautions even after container is emptied because they may retain product residues. For precautions see section 2.

General Occupational Hygiene: Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.

Storage Requirements: Keep container tightly closed. Keep away from heat, sparks, open flames and hot surfaces-No Smoking. Store in a cool, dry and well-ventilated place. Do not reuse container when empty.

Chemical Name / CAS No.	OSHA Exposure Limits	ACGIH Exposure Limits	Other Exposure Limits
Acetone 67-64-1	1000 ppm TWA; 2400 mg/m3 TWA	750 ppm STEL 500 ppm TWA	NIOSH: 250 ppm TWA; 590 mg/m3 TWA
Cellulose, acetate butanoate 9004-36-8			
Propylene glycol monomethyl ether acetate 108-65-6	TWA 200 ppm	TWA 50ppm	
Ethyl-3-ethoxypropionate 763-69-9	TWA: 0.75 ppm	CLV: 0.03 ppm	

Section 8 - Exposure Controls/Personal Protection

Engineering Controls: Ground and bond container and reciving equipment. Use explosion proof electrical, ventilation, lighting and motorized equipment. Use non-sparking tools. Ensure adequate ventilation.

Ventilation: General mechanical ventilation or local exhaust should be utilized to keep vapor concentrations below exposure limits (PEL & TLV). Ventilation equipment must be explosion proof.

Safe Work Practices: Eye washes and safety showers in the workplace are recommended. Avoid contact with skin and eyes. Avoid breathing vapors. Wash hands thoroughly after using and before eating, drinking or smoking. Employee education and training in the safe use and handling of this product is required under the OSHA Hazard Communication Standard 29CFR1200. Smoking in area where this material is used should be strictly prohibited. Always use protective clothing and equipment. Remove all contaminated clothing and wash thoroughly when finished working. Keep food and drink away from material and from area where material is being used. Spraying of material can cause and oxygen dificient environment. Use proper ventilation to remove vapors, mist and fumes combined with NIOSH approved respirator.

Respiratory Protection: When working with this material use a MSHA/NIOSH approved cartridge respirator or suitable respiratory protection to keep airborne mists and vapor concentrations below the PEL & TLV limits. When using in poorly ventilated and confined spaces, use a fresh-air supplying respirator or a self-contained breathing apparatus.

Eye/Face Protection: Use safety glasses with chemical splash goggles or faceshield.

Skin Protection: Use chemical resistant gloves.

Body Protection: Impervious clothing, flame retardant antistatic protective clothing. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace. **Contaminated Gear/Hygiene Practices:** Remove all contaminated clothing and wash thoroughly when finished working. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location. Keep food and drink away from materials and from area where material is being used or stored.

Section 9 - Physical & Chemical Properties

This mixture typically exhibits the following properties under normal circumstances:

Appearance Cloudy, opaque	Physical State Liquid		
Odor Organic Solvent	Odor threshold: No data available		
pH: No data available	Melting point: No data available		
Freezing point: No data available	Boiling range: 56°C		
Flash point: -4 F,-20 C	Evaporation rate: No data available		
Flammability: No data available	Explosive Limits: 1% - 13%		
Vapor Pressure: 157.3 mmHg	Vapor Density: 2.3		
Density (Lb / Gal) 7.20	Solubility: No data available		
Partition coefficient (n- No data available octanol/water):	Autoignition temperature: 315°C		
Decomposition temperature: No data available	Viscosity: No data available		
Regulatory Coating VOC g/L 345	Regulatory Coating VOC 2.88 Ib/gal		
Actual Coating VOC g/L 81	Actual Coating VOC lb/Gal 0.67		
Weight Percent Volatile 79.71	Specific Gravity (SG) 0.862		
% Weight VOC 9.38	% Weight Water 0.0		
% Wt Exempt VOC 70.34	% Vol Exempt VOC 76,58		

Section 10 - Stability and Reactivity

Stability: Stable under recommended storage conditions.

Possibility of hazardous reactions: Vapors may form explosive mixture with air. Hazardous polymerization will not occur.

Conditions to avoid: Heat, flame and sparks. Extreme temperature and direct sunlight.

Incompatible with:

Strong oxidizing agents

Hazardous products produced under decomposition:

Carbon Monoxide, Carbon Dioxide

Mixture Toxicity

Inhalation Toxicity: 81mg/L

Component Toxicity

9004-36-8	Cellulose, acetate butanoate
	Oral: 3,200 mg/kg (Rat) Dermal: 1,000 mg/kg (Guinea Pig)
108-65-6	Propylene glycol monomethyl ether acetate
	Dermal: 5 g/kg (Rabbit)

This mixture has not been tested for toxicological effects.

Acute Effects:

INHALATION - Dizziness, breathing difficulty, headaches, & loss of coordination. EYE CONTACT - Moderate irritation, tearing, redness, and blurred vision. SKIN CONTACT - Moderate irritant. Can dry and defat skin causing cracks, irritation, and dermatitis. INGESTION - Can cause gastrointestinal irritation, vomiting, nausea, & diarrhea.

Chronic Effects:

May affect liver, kidney and central nervous system with repeated exposure. Prolonged or repeated exposure may cause lung injury.

Routes of Entry

Inhalation	Skin C	ontact	Eye Contact	t Ingestion		
Target Organs					01.	
Eyes	Kidneys	Liver	Lungs	Central Nervous System	Skin	Respiratory System

Effects of Overexposure	
Short Term Exposure	Contact can irritate the skin. Exposure can irritate the eyes and respiratory tract. Exposure to high concentrations can cause dizziness, lightheadedness, and unconsciousness.
Long Term Exposure	Repeated skin exposure can cause dryness and skin cracking. This chemical has not been adequately evaluated to determine whether brain or nerve damage could occur with repeated exposure. However, many solvents and other petroleum-based chemicals have been shown to cause such damage. Effects may include reduced memory and concentration, personality changes (withdrawal, irritability), and fatigue, sleep disturbances, reduced coordination, and/or effects on the nerves to the arms and legs (weakness, "pins and needles").

The following chemicals comprise of at least 0.1% of this mixture and are listed and/or classified as carcinogens or potential carcinogens by the NTP, IARC, OSHA (mandatory listing) or ACGIH (optional listing).

CAS Number	<u>Description</u>	<u>% Weight</u>	Carcinogen Rating			
None			No Data Available			
Section 12 - Ecologic	al Information					
This material has not been tes	ted for ecological effects.					
Persistence and degradabilit	y: No data available					
Bioaccumulative potential: N	o data available					
Mobility in soil: No data availa	able					
Other adverse effects: Contai	ins photochemically reactive solven	t.				
Component Ecotoxicity	Component Ecotoxicity					
Acetone	promelas: 6210 - 8120 mg/L	mg/L [static]; 96 Hr LC agna: 10294 - 17704 r	3 mL/L; 96 Hr LC50 Pimephales 50 Lepomis macrochirus: 8300 ng/L [Static]; 48 Hr EC50 Daphnia			
	5	5				
Propylene glycol monomethy ether acetate	96 Hr LC50 Pimephale48 Hr EC50 Daphnia m		STATICJ			
Ethyl-3-ethoxypropionate	96 Hr LC50 Pimephale 48 Hr EC50 Daphnia m		tatic]			

Section 13 - Disposal Considerations

Product and container should be disposed of in accordance with all local, regional, national and international regulations. Contact a licensed professional waste disposal service to dispose of this material. Subject to hazardous waste generation, treatment, storage and disposal rules under RCRA, 40CFR261.

Section 14 - Transportation Information

The following transportation information is provided based on Transtar Autobody Technologies interpretation of shipping regulations. Each shipper is responsible for identifying, naming, marking and labeling prior to offering for transport.

Agency	Proper Shipping Name	<u>UN Number</u>	Packing Group	Hazard Class
IATA	Paint Related Material	UN1263	II	3
IMDG	Paint Related Material	UN1263	II	3
USDOT	Paint Related Material	UN1263	II	3
	For inner packagings not exceeding 5L each packaged in a strong outer box. Limited Quantity			

For inner packagings not exceeding 5L each packaged in a strong outer box: Limited Quantity

Section 15 - Regulatory Information

The information listed in this section is not all inclusive of all regulations for this product or the chemical components of this product.

Australia-AICS: The following chemicals are listed:

763-69-9 Ethyl-3-ethoxypropionate 1 to 5 %
108-65-6 Propylene glycol monomethyl ether acetate 5 to 10 %
28931-47-7 urea, non hazardous, polymer with formaldehyde and 2-methylpropanal 5 to 10 %
9004-36-8 Cellulose, acetate butanoate 10 to 20 %
67-64-1 Acetone 70 to 80 %

China-SEPA (IECSC): The following chemicals are listed :

763-69-9 Ethyl-3-ethoxypropionate 1 to 5 %
108-65-6 Propylene glycol monomethyl ether acetate 5 to 10 %
28931-47-7 urea, non hazardous, polymer with formaldehyde and 2-methylpropanal 5 to 10 %
9004-36-8 Cellulose, acetate butanoate 10 to 20 %
67-64-1 Acetone 70 to 80 %

DSL Status: The following chemicals are listed on the DSL Inventory.

763-69-9 Ethyl-3-ethoxypropionate 1 to 5 %
108-65-6 Propylene glycol monomethyl ether acetate 5 to 10 %
28931-47-7 urea, non hazardous, polymer with formaldehyde and 2-methylpropanal 5 to 10 %
9004-36-8 Cellulose, acetate butanoate 10 to 20 %
67-64-1 Acetone 70 to 80 %

HAPS: This formulation contains the following HAPS:

- None

NDSL Status

- None

NJ RTK: The following chemicals are listed under New Jersey RTK 67-64-1 Acetone 70 to 80 %

California Proposition 65

MARNING: This product can expose you to chemicals including

872-50-4 N-Methyl-2-pyrrolidone 400 to 500 PPM

, which is[are] known to the State of California to cause birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.

California Proposition 65

MARNING: This product can expose you to chemicals including

- None

which is[are] known to the State of California to cause cancer. For more information go to www.P65Warnings.ca.gov.

PA RTK: The following chemicals are listed under Pennsylvania RTK: 67-64-1 Acetone 70 to 80 %

SARA 312: This Product contains the following chemcials subject to the reporting requirements of SARA 312: 872-50-4 N-Methyl-2-pyrrolidone 400 to 500 PPM

SARA 313: This Product contains the following chemcials subject to the reporting requirements of SARA 313: - None

TSCA: The following are not listed under TSCA:

- None


Section 16 - Other Information

Note: HMIS Ratings involve data and interpretings that can vary from company to company. They are intended only for rapid, general identification of the magnitude of the specific hazard. To deal adequately with the safe handling of this material, all the information contained in this MSDS must be considered.

Hazardous Material Information System (HMIS)



National Fire Protection Association (NFPA)

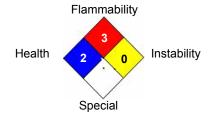

Date Prepared: 4/12/2018

To the best of our knowledge, the information contained herein is accurate, obtained from sources believed by Transtar Autobody Technologies to be accurate. As with all chemicals, **KEEP AWAY FROM CHILDREN AND ANIMALS. FOR PROFESSIONAL AND INDUSTRIAL USE ONLY.** The hazard information contained herein is offered solely for the consideration of the user, subject to his own investigation and verification of compliance with applicable regulations, including the safe use of the product under every foreseeable condition.